higher education & training

Department:
Higher Education and Training
REPUBLIC OF SOUTH AFRICA

T1060**(E)**(J23)T

NATIONAL CERTIFICATE: MULTI-DISCIPLINARY DRAWING OFFICE PRACTICE

MECHANICAL DRAUGHTING

(8090244)

23 July 2018 (X-Paper)
09:00–13:00

CLOSED-BOOK EXAMINATION

REQUIREMENTS: A2, A3 and A4 drawing sheets

This question paper consists of 9 pages.

Copyright reserved

DEPARTMENT OF HIGHER EDUCATION AND TRAINING
REPUBLIC OF SOUTH AFRICA

NATIONAL CERTIFICATE: MULTI-DISCIPLINARY DRAWING OFFICE PRACTICE
MECHANICAL DRAUGHTING
TIME: 4 HOURS
MARKS: 100

INSTRUCTIONS AND INFORMATION

1. Answer ALL the questions.
2. Read ALL the questions carefully.
3. Number the answers according to the numbering system used in this question paper.
4. Each drawing question must be answered on a separate A2, A3 or A4 DRAWING SHEET when using the computer.
5. A balanced layout is very important and candidates will be penalised for poor planning.
6. Before any drawing work is commenced, a border line must be retrieved from the symbols directory and displayed on the screen.
7. Plot answers on ONE side of the DRAWING SHEET when using a computer.
8. ALL candidate information must be plotted in the title block.
9. Candidates will be responsible for plotting their own answers under suitable supervision.
10. ALL standard drawing symbols (mechanical) may be obtained from the symbols directory when using a computer.
11. Unspecified radii must be R3.
12. ALL drawing work must conform to the latest SANS 10111 Code of Practice for Engineering Drawing.
13. Write neatly and legibly.

Copyright reserved

QUESTION 1: DISC CAMS

Cams are found in most branches of engineering to turn rotary motion into a perpendicular lift away from the shaft.

You are required by your supervisor to draw, to scale 1 : 1, a full profile of a disc cam for a motor manufacturing company with the following specifications:

Follower: Knife-edge

Cam data:

Shaft diameter:	30 mm
Minimum diameter:	40 mm
Stroke height (lift/fall):	36 mm
Performance:	Rises 36 mm in the first 180° of cam rotation according to simple harmonic motion. Falls 36 mm in the next 180° of cam rotation according to constant velocity. The rotation of the cam is anticlockwise.

Show the displacement diagram and ALL construction lines. The displacement diagram must be drawn on the left-hand side of the cam profile.

NOTE: The knife-edge follower need not be drawn. **[15]**

QUESTION 2: COMPRESSION SPRING

Control of motion in machines can be achieved by a helical compression spring.

You, as the design technician of your company, must prepare the working drawing for a left-hand helical compression spring. The sectional front view of the spring must be drawn according to conventional representation and scale 1 : 1 with the following spring data:

Outside diameter:	64 mm
Lead:	16 mm
Free length:	144 mm
Wire size:	8 mm

[10]

Copyright reserved

QUESTION 3: SECTIONAL DRAWING

FIGURE 1 on the next page shows two views of a machine casting.

Draw, to scale 1 : 1, the following views of the casting in third-angle orthographic projection:

3.1 A sectional front view on cutting plane X–X (9)

3.2 A sectional right view on cutting plane Y–Y (7)

Insert only the following symbols and dimensions on the drawing:

3.3 At A: Indicate that a hole with a diameter of 20 mm has an upper deviation of 15 micrometres and a lower deviation of -10 micrometres. (1)

3.4 At B: Indicate a distance of 45 mm with an upper deviation of 10 micrometres and a lower deviation of -15 micrometres. (1)

3.5 At C: Indicate that a surface texture with a roughness value of 25 micrometre must be produced by turning. (2)

Copyright reserved

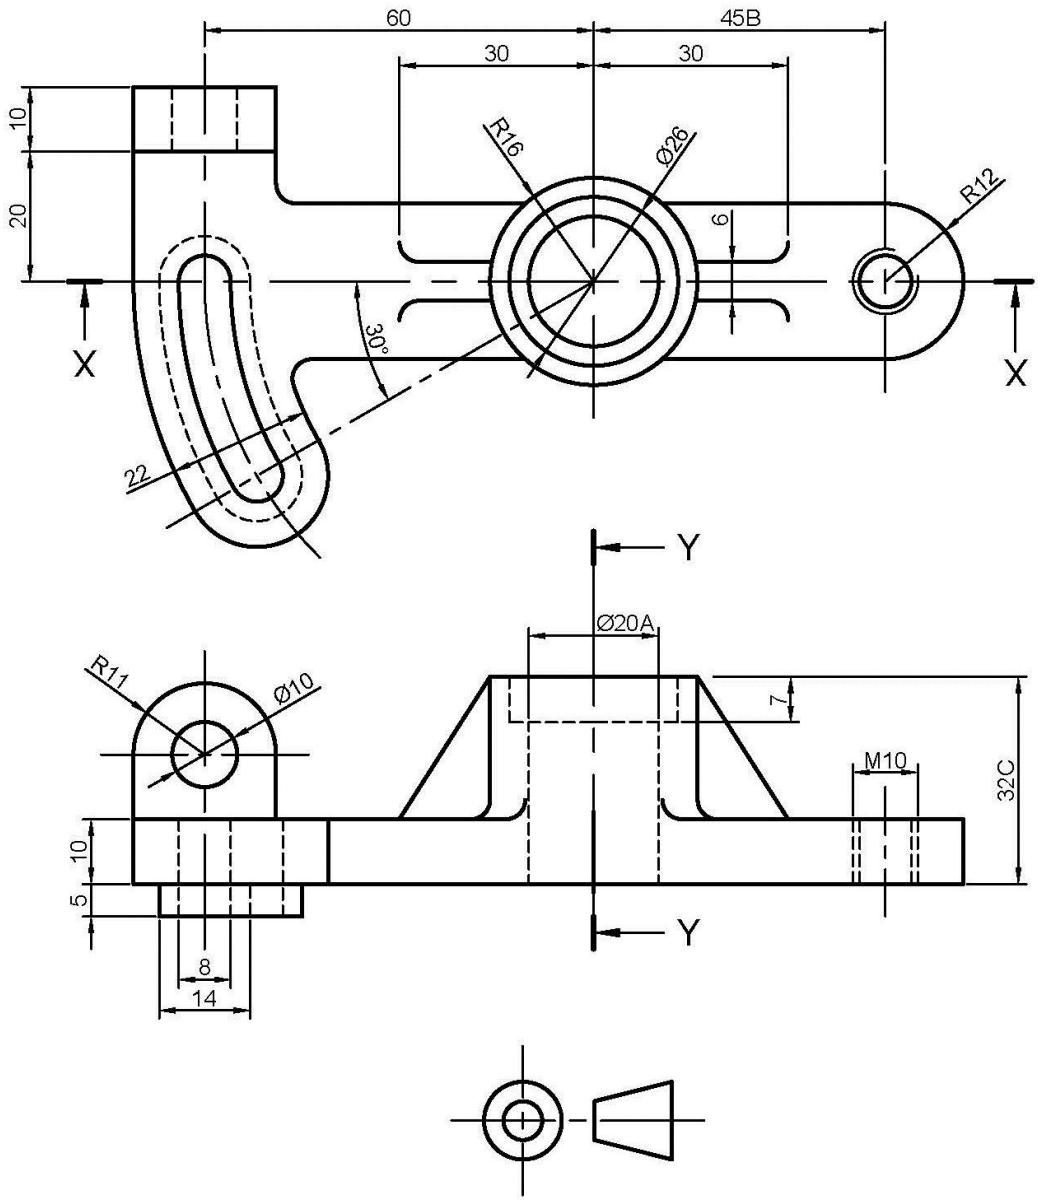

60
45B
30
30
10
20
R16
Ø26
R12
6
X
X
30°
22
Y
Ø20A
R11
Ø10
7
M10
32C
10
5
8
14
Y

FIGURE 1 **[20]**

QUESTION 4: DETAIL DRAWING

FIGURE 2 on the next page shows two views of a clamping device assembly which consists of the following:

ITEM	DESCRIPTION
1	Base
2	G-clamp
3	Workpiece
4	Screw
5	Pin
6	Locating pin

Draw, to scale 1 : 1, detailed drawings of the following components in third-angle orthographic projection:

4.1 The base (item 1) a full-sectional front view on X-X (5)

4.2 The G-clamp (item 2) showing the following:

4.2.1 A full-sectional front view on X-X (5)

4.2.2 A right view (6)

4.2.3 A top view (6)

Copyright reserved

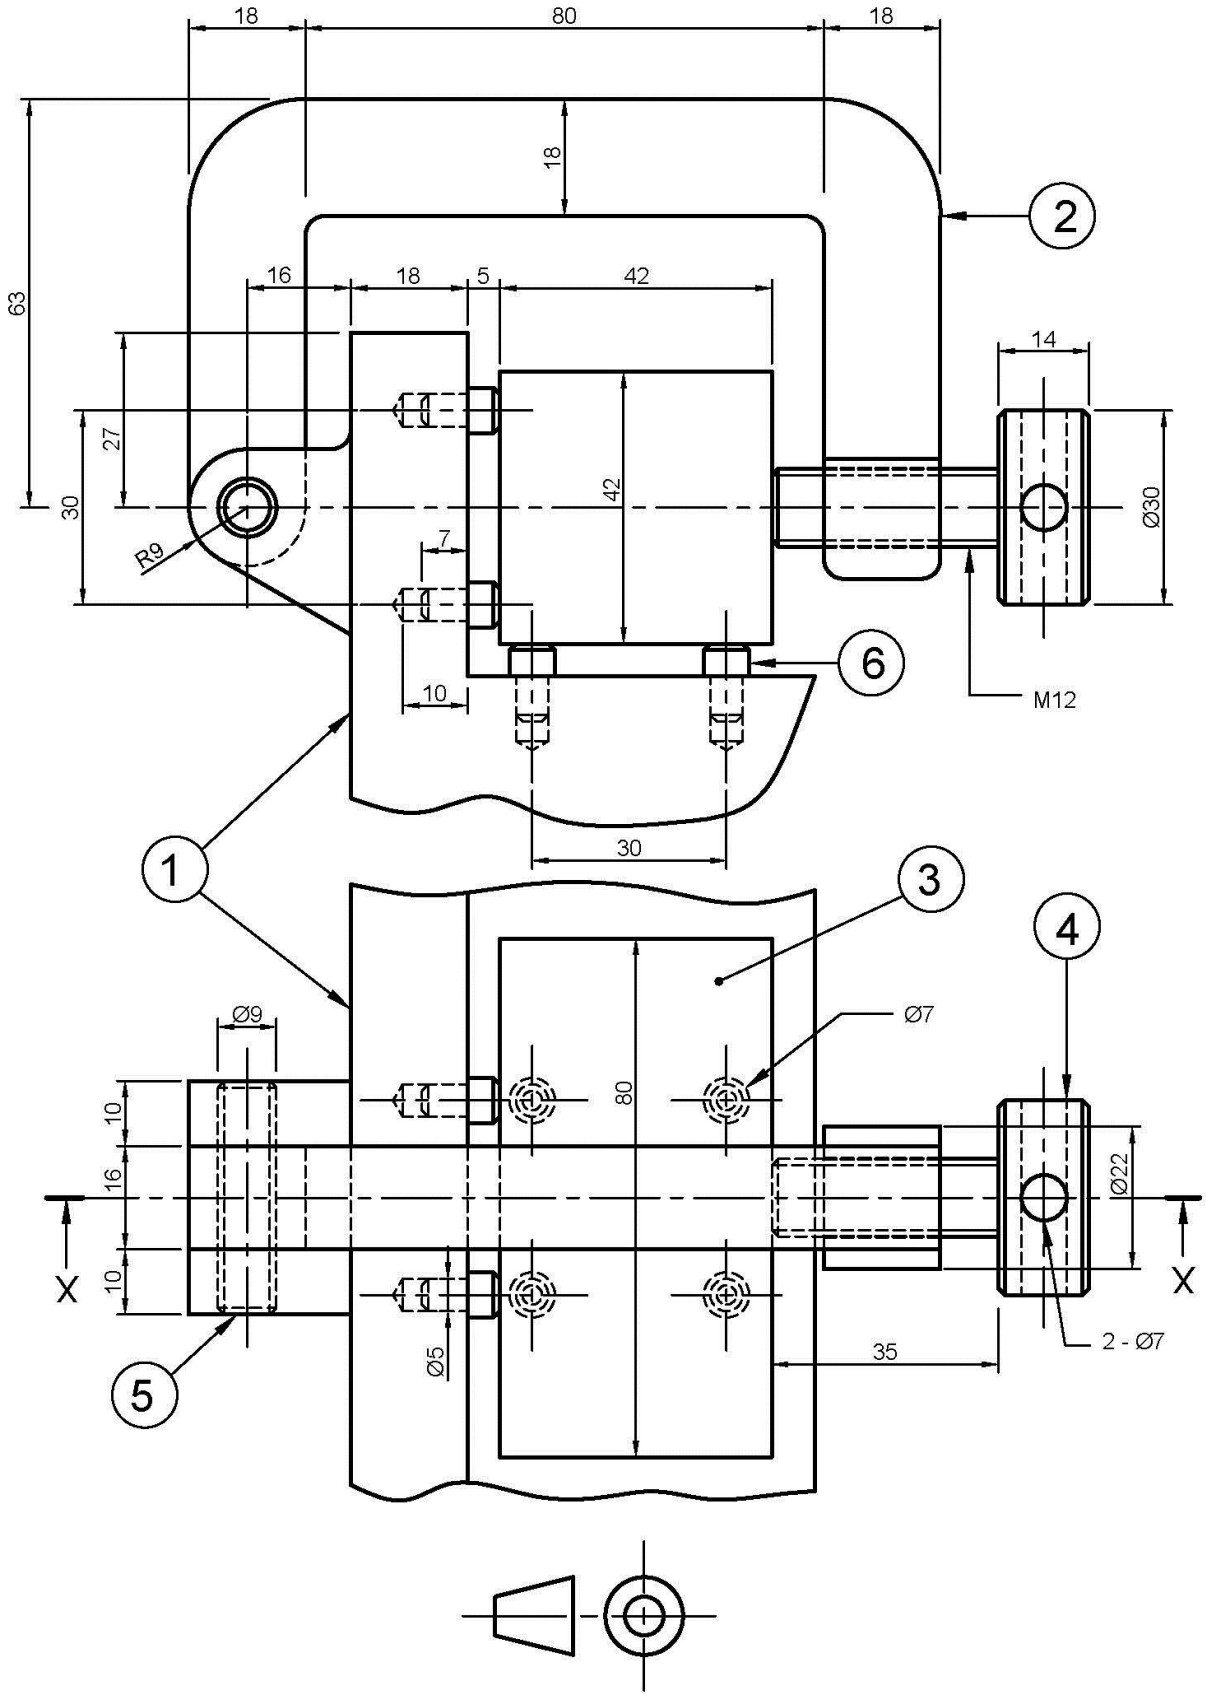

18
80
18
18
63
2
16
18
5
42
14
27
42
30
Ø30
R9
7
6
10
M12
30
1
3
4
Ø9
Ø7
10
80
16
Ø22
X
X
10
Ø5
35
2 - Ø7
5

FIGURE 2 **[22]**

QUESTION 5: ASSEMBLY DRAWING

FIGURE 3 on the next page shows the components of a screw jack.

The complete list of parts is as follows:

ITEM	PART	AMOUNT	MATERIAL
Item 1	Body	1	Cast iron
Item 2	Screw spindle	1	Mild steel
Item 3	Tommy bar	1	Mild steel
Item 4	Cup	1	Cast steel
Item 5	Special washer	1	Mild steel
Item 6	Nut	1	Gun metal
Item 7	Screw	1	Mild steel

Draw, to scale 1 : 1, an assembly drawing showing a half-sectional front view of the screw jack with the right half in section.

Show hidden detail on the half not in section.

Copyright reserved

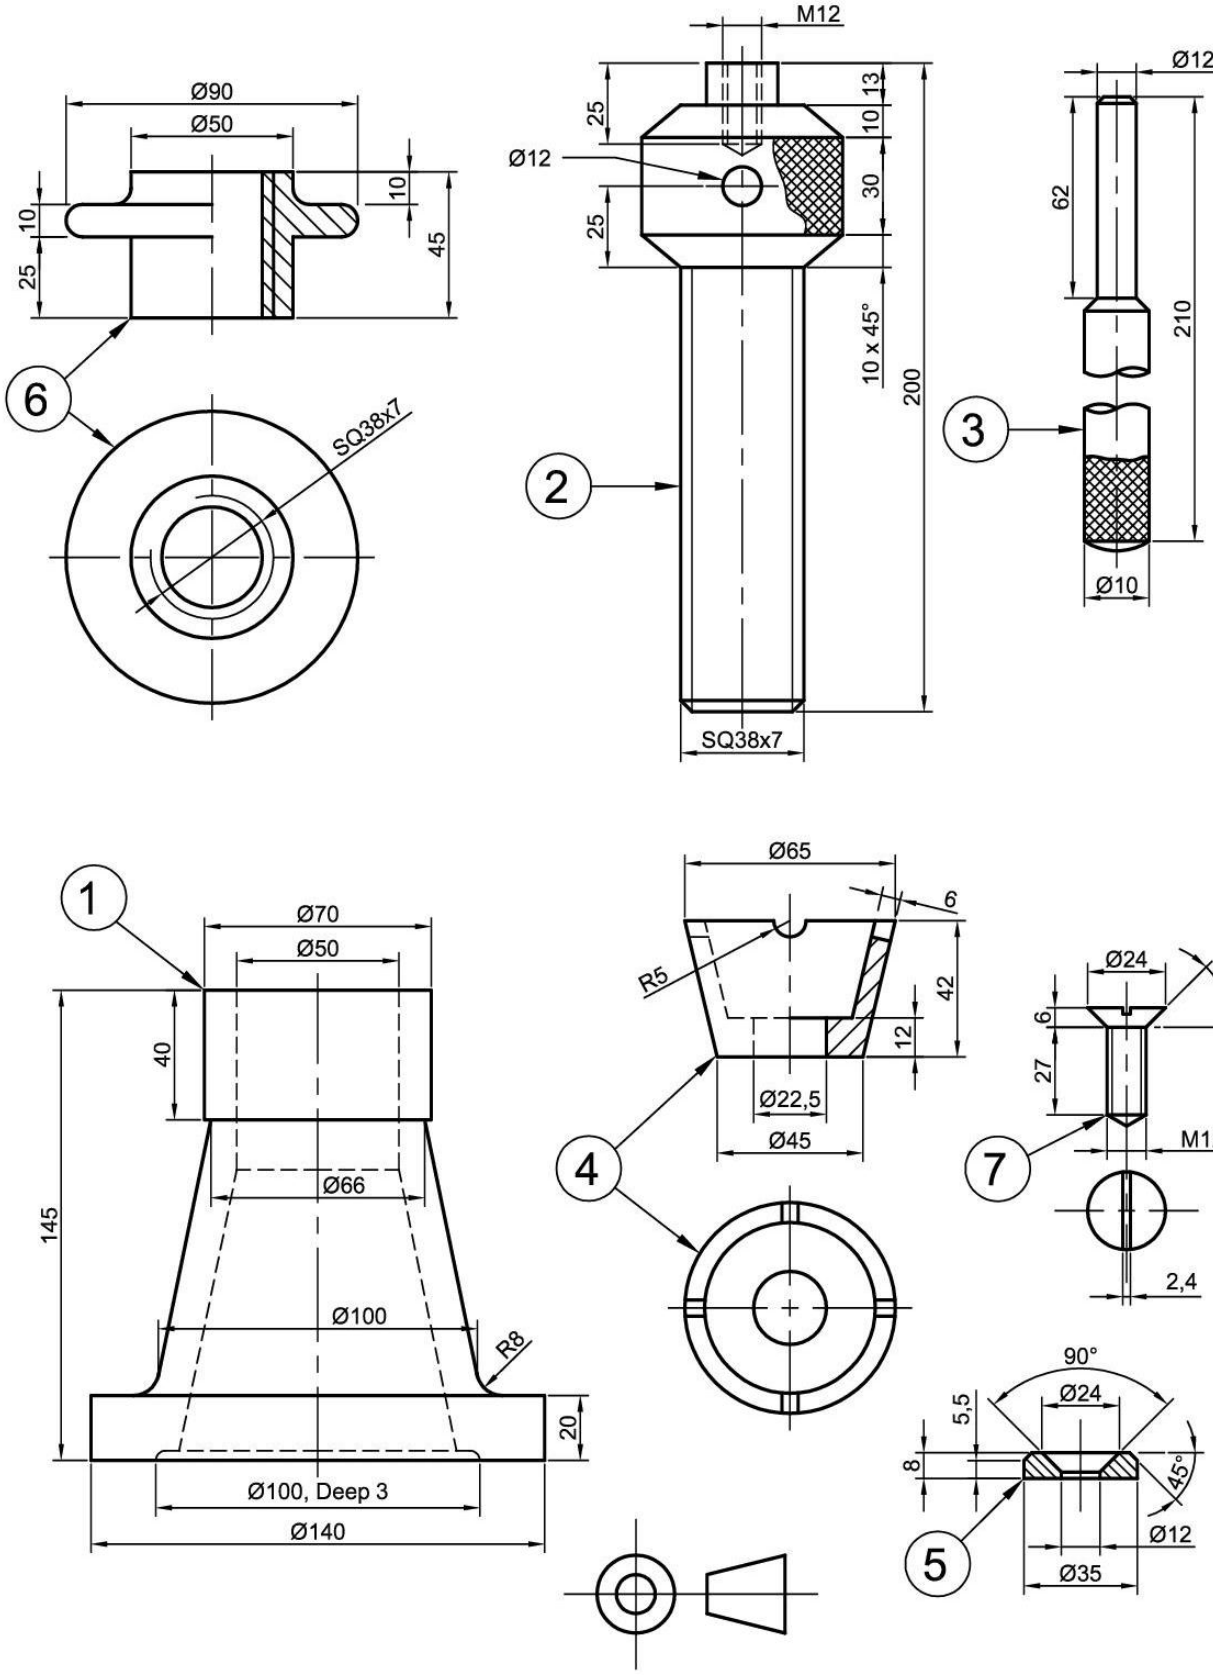


FIGURE 3 **[28]**

NOTE: Layout, neatness and general impression of the ANSWER SHEET. **[5]**

TOTAL: 100

Copyright reserved